

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

CHILD SEATS:

None during October 2015.

EQUIPMENT:

The Chamberlain Group, Inc. (Chamberlain) is recalling certain Portable Jump Starters, model CA1000, manufactured August 1, 2014, to September 9, 2015. The affected jump starters are able to be charged when the internal battery is either too hot or too cold for charging, possibly resulting in the unit overheating. If the portable jump starter overheats, it would increase the risk of a fire. Chamberlain will notify owners and provide them with a full refund of the portable jump starter. The recall began on October 13, 2015. Owners may contact Chamberlain customer service at 1-877-277-7135.

15E-079

SAF-Holland is recalling certain 5-Inch Tapered Axles used in trailer applications, part numbers 24790175090, 24790745090, and 24790165090, manufactured December 13, 2011, to December 25, 2011. In the affected axles, the wheel end may separate from the axle due to an out of specification material thickness on the spindle. A wheel end that separates from the trailer axle increases the risk of a crash. The recall began on November 2, 2015. Owners may contact SAF-Holland customer service at 1-888-396-6501.

15E-080

Hale Products Inc. (Hale) is recalling certain K Gearboxes manufactured December 20, 2014, to August 3, 2015. These gearboxes are used in fire apparatus to transfer engine power from driving a fire hose pump to turning the vehicle driveshaft. The affected gearboxes, sizes XK and LK, may shift out of gear from "road" to "neutral" while in the fire truck is in transit. If the vehicle unexpectedly shifts to neutral on the way to attend a fire, the delay may hinder fire fighting efforts. Additionally, the loss of drive may increase the risk of a crash. Hale will notify owners, and dealers will remove the gearbox and ship it to Hale to be remedied. Once repaired, it will be reinstalled. This work will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hale customer service at 1-800-533-3569. Hale's number for this recall is SB 129.

15E-081

Dorman Products, Inc. (Dorman) is recalling certain model Dorman Steering Shafts, part number 425-359, Solutions Steering Shafts, part number 7-0359, and OE Solutions Steering Shafts, part number 425-359, manufactured April 17, 2014, to September 28, 2015. These aftermarket replacement steering shafts are sold for use in 1995-2002 Ford Crown Victoria, Mercury Grand Marquis, and Lincoln Town Car vehicles. These steering shafts may separate during operation if the integral fastener is loose or missing and if the interfacing vehicle shaft is compressed in length. If the shafts separate during vehicle operation, a loss of steering control would result, increasing the risk of a vehicle crash. Dorman will notify owners, and dealers will replace the steering shaft, free of charge. The recall began on October 28, 2015. Owners may contact Dorman customer service at 1-800-523-2492, option 5.

15E-082

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Meritor, Inc. (Meritor) is recalling certain Meritor EX225L2, EX225L+, and Bendix ADB22X axles manufactured December 9, 2013, to August 25, 2015. The affected axle assemblies have caliper bolts that may not have been properly tightened, allowing the caliper mounting bolts to back out and the caliper to detach from the axle flange. If the caliper detaches from the axle flange, braking performance would be reduced, increasing the risk of a crash. Meritor will notify the vehicle manufacturers that purchased the axles. The vehicle manufacturers will notify owners, and their dealers will inspect the caliper bolts, tightening them as necessary, free of charge. The recall began on November 13, 2015. Owners may contact Meritor customer service at 1-866-668-7221.

15E-083

Hale Products Inc. (Hale) is recalling certain Quenching Agent Level Pressure Sensors, Class 1 ITL Level Displays, manufactured May 1, 2015, to July 31, 2015. When the vehicle is stationary, the affected sensors may give an incorrect reading of the remaining fire fighting agent (typically water or firefighting foam) left in the tank. If there is an incorrect reading of agent in the tank, it can increase the risk of injury to the fire fighter if the tank unexpectedly runs out of agent. Hale will notify owners, and dealers will either recalibrate the system or replace the pressure sensor, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Hale customer service at 1-800-533-3569.

15E-084

Cummins Inc. (Cummins) is recalling certain Cummins Westport ISL G engines manufactured September 13, 2007, to September 23, 2015. The affected engines were sold for use exclusively in Mack Trucks and Navistar vehicles, both as original equipment and as replacement equipment. These engines have a turbocharger oil supply line that may contact or interfere with the turbocharger inlet elbow, clean air intake clamp, or the air fuel control tube, and result in an oil leak. If the turbocharger oil supply line oil leaks in the proximity of the engine exhaust manifold there would be an increased risk of a fire. Cummins will notify owners, and dealers will inspect for oil supply line interference or damage, eliminating the interference and replacing the oil supply line, as necessary, free of charge. The recall is expected to begin November 20, 2015. Owners may contact Cummins at 1-800-343-7357. Cummins' number for this recall is C1673.

15E-085

ECCO is recalling certain portable and magnetically mountable LED Worklamps, part numbers EW2461 and EW2461-NA, manufactured October 1, 2014, to December 31, 2014. The affected work/utility lamps are powered by a rechargeable Lithium-ion battery that can be charged using a vehicle charger (12 volt adapter) or an AC adapter. These lamps may overheat. A lamp that overheats increases the risk of injury or fire. ECCO will notify owners and will replace the worklamps, free of charge. The recall began on November 6, 2015. Owners may contact ECCO customer service at 1-800-635-5900.

15E-086

Atwood Mobile Products (Atwood) is recalling certain On Demand Water Heaters, models OD45, OD50, OD50CW, manufactured January 2, 2012, to August 13, 2015. The affected water heaters have a water and gas valve that may cause the water heater to overheat the water in the hot water supply tap. The overheating of the water may result in the release of steam, possibly causing the operator is to scald themselves and increasing

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING OCTOBER 2015

Published November 18, 2015

the risk of injury. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Atwood customer service at 1-574-264-2131.

15E-087

Johnson Controls, Inc. (Johnson Controls) is recalling certain Recaro Ergo-M Commercial Bus Driver Seats, part number AM 80-Ergo M, manufactured April 5, 2010, to October 14, 2015. The affected seats have J-Brackets that may be missing welds which could allow the seat belt anchorage assembly to separate from the J-Bracket. If the seatbelt anchorage assembly separates from the J-Bracket, the bus driver may not be properly restrained in the event of a crash increasing their risk of injury. Johnson Controls will notify the bus manufacturers that purchased the affected seats. Their dealers will inspect the seats to determine if welds are missing. Any J-Bracket that is missing welds will be removed and replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Johnson Controls customer service at 1-248-484-3203.

15E-088

TIRES:

None during October 2015.

VEHICLES:

General Motors (GM) is recalling certain model year 2013-2014 Chevrolet Silverado HD, Chevrolet Express, and GMC Sierra HD vehicles, and model year 2013 GMC Savana compressed natural gas (CNG) vehicles that fail to comply with Federal Motor Vehicle Safety Standard No. 303 "Fuel System Integrity of Compressed Natural Gas Vehicles." In the affected vehicles, the text of the CNG fuel-only label is smaller than the required size, and as a result, may be less noticeable. Text that does not conform to the required labeling size could inhibit fuel tank inspection practices and safe refueling, increasing the risk of a fire. GM will notify owners and will send them a replacement label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 13365.

13V-544

Pierce Manufacturing (Pierce) is recalling certain model year 2006-2007 Arrow XT, Dash, Enforcer, Lance, and Quantum vehicles manufactured January 1, 2006, to March 31, 2007. In the affected vehicles, tears in the ball joint protective boots may result in contamination of the ball joints. The contamination may cause premature ball joint failure and the wheel to disengage from the control arm, increasing the risk of a vehicle crash. Pierce will notify owners, and dealers will inspect the affected vehicles for torn ball joint boots. Pierce will also evaluate the ball joint wear. Ball joints with an unexpected level of wear will be replaced. These repairs will be performed free of charge. The recall is expected to begin November 30, 2015. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B267.

15V-615

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2011-2014 Cascadia, Business Class M2, Coronado, and Columbia Glider vehicles manufactured April 5, 2010, to June 15, 2013. The affected trucks are equipped with Fontaine Ultra LT Fifth Wheel connectors, which, due to cumulative damage to the fifth wheel and its locking mechanism, have a locking mechanism that may fail to operate or to properly engage. If the fifth wheel and locking mechanism are sufficiently damaged, the locking mechanism may fail to operate as intended and the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. DTNA will notify owners, and DTNA authorized service facilities will replace the fifth wheel with an Ultra NT model fifth wheel, free of charge. The recall is expected to begin November 28, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-692.

15V-616

Daimler Trucks North America, LLC (DTNA) is recalling certain model year 2015-2016 Freightliner Cascadia, Business Class M2, 108SD, 114SD, and Western Star 4700 trucks manufactured January 4, 2015, to April 24, 2015, and equipped with Eaton Fuller FR 10-speed manual transmissions. In the affected vehicles, when the transmission shift lever is moved from reverse to neutral, the reverse gear may stay engaged. When the transmission shift lever is moved from reverse to a forward gear position, the transmission may mechanically lock because both the reverse gear and forward gear are simultaneously engaged. Even though the transmission has been shifted out of reverse into neutral, the vehicle may unexpectedly move backwards, increasing the risk of a crash. DTNA will notify owners, and dealers will inspect and repair the affected transmissions if necessary, free of charge. The recall is expected to begin November 28, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-693.

15V-617

Ford Motor Company (Ford) is recalling certain model year 2016 Ford Fusion vehicles manufactured September 3, 2015, to September 13, 2015, and 2016 Lincoln MKZ vehicles manufactured September 3, 2015, to September 12, 2015. The affected vehicles have a fuel tank that may have insufficient wall thickness. As a result, the fuel tanks may crack in the event of a crash and thus the vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity." A fuel tank that cracks may leak fuel, increasing the risk of a fire. Ford will notify owners, and dealers will replace the fuel tank, free of charge. The recall began on October 19, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C11.

15V-618

C&B Quality Trailer Works, Inc. (C&B Quality) is recalling certain model year 2015-2016 Horse Trailers manufactured from February 25, 2015, through September 15, 2015, and equipped with 3500lb-capacity axles. The weld that secures the torsion arm assembly may fail allowing the tire, wheel, hub, and torsion arm to separate from the trailer. A separation of the torsion arm can result in a reduction in vehicle stability, increasing the risk of a crash. C&B Quality will notify owners, and the axle manufacture will supply a replacement axle free of charge and cover the labor costs needed to replace it. The recall began on October 20, 2015. Owners may contact C&B Quality Trailer Works, Inc. at 1-208-455-2768.

15V-619

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2016 Freightliner Cascadia, Business Class M2, 108SD, 114SD, and 122SD, Western Star 4700 and 4900, Thomas Built Buses Saf-T-Liner C2, and Freightliner MT55 vehicles manufactured August 7, 2015, to August 26, 2015. The affected vehicles are equipped with certain Cummins ISB6.7, ISL9, ISX12 or ISX15 engines whose engine control module (ECM) may short circuit and blow a fuse resulting in the engine stalling without warning. An engine that stalls without warning increases the risk of a crash. DTNA will notify owners, and dealers will replace the ECM free of charge. The recall is expected to begin November 28, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-690.

15V-620

Mazda North American Operations (Mazda) is recalling certain model year 2015-2016 Mazda3 vehicles manufactured May 21, 2015, to August 25, 2015. The affected vehicles are equipped with a fuel tank with a shut-off valve that can allow fuel to enter into the fuel tank emissions systems. If enough fuel enters the emission system it may leak out onto the ground or result in an engine stall. A fuel leak in the presence of an ignition source increases the risk of a fire. An engine that stalls increases the risk of a crash. Mazda will notify owners, and dealers will inspect the vehicle's fuel shut-off valve. As needed, the fuel shut-off valve and the affected fuel tank emissions system components will be replaced, free of charge. The recall began on October 20, 2015. Owners are advised not to drive their vehicle until the repairs have been completed. Mazda will provide rental cars until that time. Owners may contact the Mazda Customer Experience Center at 1-800- 222-5500, option #6. Mazda's number for this recall is 8615J.

15V-621

Snake River Trailer Company (Snake River) is recalling certain model year 2015-2016 Horse trailers manufactured February 25, 2015, to September 15, 2015, and equipped with 3500lb-capacity torsion model axles. The weld that secures the torsion arm assembly may fail allowing the tire, wheel, hub, and torsion arm to separate from the trailer. A separation of the torsion arm can result in a reduction in vehicle stability, increasing the risk of a crash. Snake River will notify owners, and the axle manufacture will supply a replacement axle free of charge and cover the labor costs needed to replace it. Owners may contact Snake River customer service at 1-208-459-8344.

15V-622

Daimler Trucks North America LLC (DTNA) is recalling certain model year 2016 Thomas Built Bus Saf-T-Liner C2 school buses manufactured August 6, 2015, to August 20, 2015, and equipped with certain Cummins ISB6.7 engines whose engine control module (ECM) may short circuit and blow a fuse resulting in the engine stalling without warning. An engine that stalls without warning increases the risk of a crash. DTNA will notify owners, and dealers will replace the ECM, free of charge. The recall began on October 22, 2015. Owners may contact DTNA customer service at 1-800-745-8000. DTNA's number for this recall is FL-690.

15V-623

Riverside RV is recalling certain model year 2015 Retro Travel Trailers, models 177SE, 166, 195, and 509, manufactured May 1, 2015, to July 31, 2015 and equipped with Coker whitewall tires. The affected trailers are equipped with Tire and Loading labels that list incorrect tire pressure information. As such, these vehicles fail to

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

comply with the requirements of 49 CFR Part 574, "Tire Identification & Recordkeeping." If an owner inflates the tires to the incorrect pressure listed on the label, the tire may be overinflated, and a tire blow out may occur, increasing the risk of a crash. Riverside has reprinted and sent the corrected labels to owners and dealers, free of charge. The recall began on September 1, 2015. Owners may contact Riverside customer service at 1-260-499-4578.

15V-624

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2013-2016 Winnebago Era, Travato, View, Trend, Via, Journey, and Tour motorhomes and Itasca Navion, Viva, Reyo, Meridian, and Elipse motorhomes manufactured June 26, 2012, to August 26, 2015. In the affected vehicles, the high pressure liquid propane (LP) hose may harden and result in an LP leak at the crimp fitting. An LP leak in the presence of an ignition source increases the risk of a fire. Winnebago will notify owners, and dealers will replace the LP hose, free of charge. Remedy parts are not currently available. The recall is scheduled to begin on November 25, 2015. Owners may contact Winnebago customer service at 1-641-585-3535.

15V-625

Kia Motors America (Kia) is recalling certain model year 2011-2013 Kia Sorento vehicles manufactured October 19, 2009, to January 31, 2013. In the affected vehicles, if excessive force is applied to the gear shift lever, the brake-shift interlock mechanism may chip or crack allowing the transmission being able to be shifted out of "Park" without the brakes being depressed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection." Without requiring the brake to be pressed, the vehicle may be unintentionally shifted out of Park, allowing it to roll, which may result in a crash. Kia will notify owners, and dealers will replace the brake-shift interlock mechanism, free of charge. The recall is expected to begin November 24, 2015. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC124.

15V-626

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015 Jetta vehicles manufactured September 8, 2014, to November 28, 2014, Golf vehicles manufactured April 2, 2014, to December 3, 2014, and E-Golf vehicles manufactured July 26, 2014, to October 18, 2014. The affected vehicles are equipped a Passenger Occupant Detection System (PODS) that may have been manufactured improperly. As a result, the front passenger seat occupant may be improperly classified or may not be detected. In the event of a crash, if the front passenger seat occupant is incorrectly classified or non-detected, the passenger frontal air bag may deploy improperly or not at all, increasing the risk of occupant injury. Volkswagen will notify owners, and dealers will replace the PODS control module, free of charge. The recall began in November 2015. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69L6.

15V-627

BMW of North America, LLC (BMW) is recalling certain model year 2014-2016 MINI Cooper S and MINI Cooper two-door vehicles, 2015-2016 MINI John Cooper Works and MINI Cooper S and MINI Cooper four-door vehicles and 2014-2015 BMW i3 vehicles. Due to a manufacturing error, the passenger frontal air

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

bag may not deploy properly in a low speed crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a vehicle crash, an air bag that does not deploy properly increases the risk of injury to the front seat passenger. MINI and BMW will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. The recall is expected to begin on November 20, 2015. Owners may contact MINI customer service at 1-866-825-1525 and BMW customer service at 1-800-525-7417.

15V-628

Hyundai Motor America (Hyundai) is recalling certain model year 2011 Elantra vehicles manufactured November 12, 2010, to March 31, 2011, and Sonata vehicles manufactured December 11, 2009, to February 28, 2010, originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. Road salt may corrode the front coil springs, possibly resulting in the coil springs fracturing. If a front coil spring fractures, it may contact the tire, possibly puncturing it, increasing the risk of a crash. Hyundai will notify owners, and dealers will replace the front coil springs, free of charge. The recall is expected to begin November 30, 2015. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 133. Note: Vehicles that were previously registered in salt belt states but are currently registered elsewhere are eligible to be inspected and repaired.

15V-629

Volvo Trucks North America (Volvo) is recalling certain model year 2015-2016 VAH and VHD trucks manufactured April 1, 2014, to August 14, 2015. The affected vehicles may be equipped with headlights that do not meet the minimum intensity requirements, resulting in insufficient illumination of the roadway. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." Headlights that provide insufficient illumination increase the risk of a crash. Volvo will notify owners, and dealers will replace the headlights, free of charge. The recall is expected to begin December 3, 2015. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1505.

15V-630

Navistar Inc. (Navistar) is recalling certain model year 2016 International ProStar trucks manufactured August 5, 2015, to August 14, 2015, DuraStar trucks manufactured August 7, 2015, to August 13, 2015, Paystar trucks manufactured August 11, 2015, to August 14, 2015, and LoneStar trucks manufactured August 10, 2015, to August 14, 2015. In the affected vehicles, the Engine Control Module (ECM) may short circuit, causing the engine to stall without warning. An engine that stalls without warning increases the risk of a crash. Navistar will notify owners, and Cummins dealers will replace the ECM, free of charge. The recall began on October 22, 2015. Owners may contact Navistar customer service at 1-800-448-7825, or Cummins customer service at 1-800-343-7357.

15V-631

Kovatch Mobile Equipment Corp. (KME) is recalling certain model year 2013-2015 Predator emergency

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

vehicles manufactured January 23, 2013, to January 28, 2015. The affected vehicles have front independent suspension assemblies that may have loose ball joints which could separate causing a loss of steering control. A loss of steering control increases the risk of a crash. KME will notify owners, and dealers will correct the ball joint installation, free of charge. The recall began on October 30, 2015. Owners may contact KME customer service at 1-800-235-3926.

15V-632

Spartan Motors USA (Spartan) is recalling certain model year 2003-2005 MM and K2 motorhome chassis manufactured January 20, 2003, to May 16, 2005. The affected vehicles have a steering gear mounting bracket that may crack, causing a loss of steering ability. A loss of steering increases the risk of a crash. Spartan will notify owners, and dealers will replace the steering gear mounting brackets, free of charge. The recall is expected to begin during November 2015. Owners may contact Spartan customer service at 1-800-543-4277. Spartan's number for this recall is 15022.

15V-633

Volvo Trucks North America (Volvo) is recalling certain model year 2012-2014 Volvo VNL trucks manufactured December 1, 2011, to September 1, 2013, equipped with certain Electric Auxiliary Power Units (APU), part number BA600, manufactured by Idle Free Systems (IFS). The affected APUs have metal housings whose mounting points may crack and tear. Additionally, the mounting bolts of the power units may loosen or possibly fail. If the mounting points crack and tear or the attaching bolts loosen or fail, the power unit may detach from the truck, becoming a road hazard and increasing the risk of a crash. Volvo will notify owners and IFS dealers will inspect the APU for damage and, where needed, install a welded gusset upgrade kit to strengthen the APU C-channels. All units will receive stronger clamping brackets. The recall is expected to begin November 20, 2015. Owners may contact Volvo customer service at 1-800-528-6586, or IFS customer service at 1-920-206-9333. Volvo's number for this recall is RVXX1506.

15V-634

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2014-2016 Breeze motorhomes manufactured September 5, 2013, to September 30, 2015. The affected assemblies may have loose ball joints which could separate causing a loss of steering control. A loss of steering control increases the risk of a crash. Tiffin will notify owners, and dealers will correct the ball joint installation, as necessary, free of charge. The recall began on October 30, 2015. Owners may contact Tiffin customer service at 1-256-356-8661.

15V-635

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Caprice vehicles manufactured August 14, 2013, to February 3, 2014, and Chevrolet SS vehicles manufactured August 15, 2013, to February 16, 2014. The affected vehicles received replacement seat base assemblies during repair service, but during the work, the seat position target bracket may not have been transferred from the old seat to the new one. Without the seat position target bracket, the air bag may deploy at a higher intensity than necessary. An air bag that deploys at a higher than intended level increases the risk of injury during a crash. GM will notify owners, and dealers will inspect the vehicles and, if necessary, install a seat frame equipped with a target bracket, free of charge. The recall is expected to begin in November 2015. Owners may contact Chevrolet customer service at

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

1-800-222-1020. GM's number for this recall is 15567.

15V-636

Ducati North America (Ducati) is recalling certain model year 2015-2016 Multistrada 1200 and 1200 S motorcycles manufactured December 1, 2014, to June 11, 2015. In the affected vehicles, the side-stand may break, due to an incorrect length of the side-stand support tube. If the side-stand breaks, the motorcycle would fall over, increasing the risk of injury to the rider and/or the passenger. Ducati will notify owners, and dealers will replace the side-stand support tubes, as necessary, free of charge. The recall began on November 5, 2015. Owners may contact Ducati customer service at 1-800-231-6696. The recall number for this recall is RCL-15-003.

15V-637

Starcraft RV is recalling certain model year 2016 Autumn Ridge travel trailers manufactured March 27, 2015, to September 22, 2015. The affected vehicles have an incorrectly built frame that may result in inadequate clearance between the wheel and the wheel well. Inadequate clearance between the wheel and the wheel well may cause premature tire wear or possible tire failure, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin during November 2015. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902258.

15V-638

Paccar (Paccar Incorporated) is recalling certain 2016 Kenworth T680, T800, and T880 trucks manufactured January 5, 2015, to January 7, 2015 and 2016 Peterbilt 367, 384, 567, and 579 trucks manufactured January 2, 2015, to January 9, 2015 and equipped with Eaton Fuller FR 10-speed manual transmissions. In the affected vehicles, when the transmission shift lever is moved from reverse to neutral, the reverse gear may stay engaged. When the transmission shift lever is moved from reverse to a forward gear position, the transmission may mechanically lock because both the reverse gear and forward gear are simultaneously engaged. Even though the transmission has been shifted out of reverse into neutral, the vehicle may unexpectedly move backwards, increasing the risk of a crash. Paccar will notify the owners, and dealers will inspect and repair the affected transmissions if necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000 or Peterbilt customer service at 1-940-591-4000. Paccar's numbers for this recall are 15KWM (Kenworth) and 1015N (Peterbilt).

15V-639

General Motors LLC (GM) is recalling certain model year 2014-2015 Chevrolet Silverado and GMC Sierra trucks manufactured January 24, 2014, to February 26, 2014, 2015 Chevrolet Suburban vehicles manufactured February 12, 2014 and Chevrolet Tahoe vehicles manufactured February 6, 2014, to February 13, 2014. In the affected vehicles, the ignition lock actuator may bind, making turning the key difficult or causing the ignition to get stuck in the "Start" position. If stuck in the "Start" position, the ignition may suddenly snap back into the "Accessory" position, causing a loss of engine, steering, and braking power, increasing the risk of a vehicle crash. If the vehicle is in a crash, the air bags may not deploy, increasing the risk of occupant injury. GM will notify owners, and dealers will replace the ignition lock housing, free of charge. The recall is expected to begin in November 2015. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

service at 1-800-462-8782. GM's number for this recall is 15573.

15V-640

Paccar Incorporated (Paccar) is recalling certain model year 2012-2013 Peterbilt 579 and 587 trucks manufactured February 14, 2011, to December 5, 2012 and 2011 Kenworth T700 trucks manufactured September 21, 2010, to October 1, 2010. The affected trucks are equipped with Fontaine Ultra LT Fifth Wheel connectors, which, due to cumulative damage to the fifth wheel and its locking mechanism, have a locking mechanism that may fail to operate or to properly engage. If the fifth wheel and locking mechanism are sufficiently damaged, the locking mechanism may fail to operate as intended and the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. PACCAR will notify owners, and dealers will replace the fifth wheel with an Ultra NT model fifth wheel, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Kenworth customer service at 1-425-828-5000 or Peterbilt customer service at 1-940-591-4000. Paccar's numbers for this recall are 15KWP (Kenworth) and 1015M (Peterbilt).

15V-641

Newmar Corporation (Newmar) is recalling certain model year 2016 Bay Star, Bay Star Sport and Canyon Star motorhomes manufactured July 8, 2015, to September 14, 2015. In the affected vehicles, the parking brake actuator may be out of calibration causing the parking brake system to not properly hold the vehicle even with the parking brake pedal fully depressed. Additionally, the parking brake may not disengage completely when the parking brake pedal is released. If the parking brake does not fully engage, the vehicle may unexpectedly roll, increasing the risk of personal injury or a crash. A parking brake that drags may result in a wheel end fire. Newmar will notify owners, and dealers will replace the parking brake foot pedal assembly, free of charge. The recall began on October 22, 2015. Owners may contact Newmar customer service at 1-800-731-8300.

15V-642

Volvo Trucks North America (Volvo) is recalling certain model year 2011-2013 VNL and VNM trucks manufactured June 21, 2010, to December 14, 2012. The affected trucks are equipped with Fontaine Ultra LT Fifth Wheel connectors, which, due to cumulative damage to the fifth wheel and its locking mechanism, have a locking mechanism that may fail to operate or to properly engage. If the fifth wheel and locking mechanism are sufficiently damaged, the locking mechanism may fail to operate as intended and the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. Volvo will notify owners, and Fontaine dealers will replace the fifth wheel with an Ultra NT model fifth wheel, free of charge. The recall is expected to begin during November 2015. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1507.

15V-643

Mack Trucks, Inc. (Mack) is recalling certain model year 2011-2014 Pinnacle (CHU and CXU) trucks manufactured September 10, 2010, to June 17, 2013. The affected trucks are equipped with Fontaine Ultra LT Fifth Wheel connectors, which, due to cumulative damage to the fifth wheel and its locking mechanism, have a locking mechanism that may fail to operate or to properly engage. If the fifth wheel and locking mechanism are sufficiently damaged, the locking mechanism may fail to operate as intended and the trailer may unexpectedly detach from the tractor, increasing the risk of a crash. Mack will notify owners, and Fontaine dealers will replace

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

the fifth wheel with an Ultra NT model fifth wheel, free of charge. The recall is expected to begin November 2, 2015. Owners may contact Mack customer service at 1-800-866-1177. Mack's number for this recall is SC0395.

15V-644

Forest River, Inc. (Forest River) is recalling certain model year 2016 Salem recreational trailers manufactured June 2, 2015, to October 6, 2015 and 2015 Wildwood recreational trailers manufactured June 3, 2015, to October 1, 2015. In the affected vehicles, the tire and wheel placard incorrectly states the wheel rim and tire size. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." If the incorrect tire and rim is installed, there may be instability of the vehicle when towing, increasing the risk of a crash. Forest River will notify owners and will provide a corrected tire placard, free of charge. The recall began on October 26, 2015. Owners may contact Forest River customer service at 1-800-453-6064. Forest River's recall number is 19-10082015-0093.

15V-645

E-One Incorporated (E-One) is recalling certain model year 2014-2015 Typhoon, Cyclone II, and Quest emergency vehicles manufactured October 28, 2014, to August 29, 2015. The affected vehicles may have left the production facility with a harness for the front air bag system disconnected. If the air bag harness is not connected to the air bag control system, the front air bag will not deploy in the event of a crash, increasing the risk of injury. E-One will notify owners, and dealers will inspect the air bag harness, connecting it as necessary, and test the system for proper operation, free of charge. The recall is expected to begin during November 2015. Owners may contact E-One customer service at 1-800-627-5050.

15V-646

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 S550 Hybrid vehicles manufactured May 13, 2013 to April 22, 2015. In the affected vehicles, after driving in electric mode, the fuel pump output may be insufficient to restart the gasoline engine and the vehicle will stall. A vehicle stall increases the risk of a crash. MBUSA will notify owners, and dealers will update the fuel system control unit software, free of charge. The recall is expected to begin in November 2015. Owners may contact Mercedes-Benz customer service at 1-800-367-6372.

15V-647

Autocar, LLC (Autocar) is recalling certain model year 2014-2016 Xpeditor vehicles manufactured January 3, 2014, to August 13, 2015. In dual-drive, right-hand stand configurations, the right-side brake plunger may stick and cause the brakes to drag. If the brake plunger is not functioning properly and affecting braking performance, a loss of vehicle control may result, increasing the risk of a crash. Autocar will notify owners, and dealers will replace the brake plunger, free of charge. The recall is expected to begin December 4, 2015. Owners may contact Autocar customer service at 1-888-218-3611. Autocar's number for this recall is ACX-1505.

15V-648

Great Dane Trailers (Great Dane) is recalling certain model year 2016 Dry Freight and Converter Dolly trailers manufactured June 19, 2015, to September 22, 2015. During production, the axle nut retaining clips may not

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

have been properly seated or may have been omitted from the axle assemblies. Without a properly seated axle nut retaining clip, the wheel nut may loosen resulting in excessive wheel end play and a loss of vehicle control, increasing the risk of a crash. Great Dane will notify owners, and dealers will inspect the vehicles to verify that the axle nut retaining clips are properly installed, correcting them as necessary, free of charge. The recall began on October 27, 2015. Owners may contact Great Dane customer service at 1-877-369-3493.

15V-649

Forest River, Inc. (Forest River) is recalling certain model year 2013-2014 Cherokee recreational trailers, model T19V, manufactured February 18, 2013, to August 14, 2013. In the affected vehicles, the Federal placard displays incorrect vehicle information. The original placard indicates that the tires on the vehicle are ST225/75R15D and the axle indicates a 5,200 lbs. capacity. However, the vehicle was built with a 3,500 lbs. axle and ST205/75R15C tires, which results in a decrease in the Gross Vehicle Weight Rating. As such, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." By relying on the incorrect Tire, Rim, GVWR and Cargo Carrying Capacity information indicated on the Federal Placards, an owner may unknowingly overload the vehicle, possibly resulting in tire or axle failure, increasing the risk of a crash. Forest River will notify owners and provide a corrected, free of charge. The recall began on October 26, 2015. Owners may contact Forest River customer service at 1-800-453-6064. Forest River's number for this campaign is 17A-10082015-0094.

15V-650

Volvo Trucks North America (Volvo) is recalling certain model year 2009-2015 Volvo VN trucks manufactured April 14, 2008, to December 23, 2014. The affected vehicles may experience corrosion of the ball joints due to the seals being compromised, possibly resulting in accelerated wear and failure of the ball joint. Failure of the ball joint may cause separation of the socket and a complete loss of steering, increasing the risk of a crash. Volvo will notify owners, and dealers will inspect and replace the drag links, free of charge. Parts are not currently available. Volvo issued an interim notification to owners on October 28, 2015. Owners may contact Volvo customer service at 1-800-528-6586. Volvo's number for the vehicle inspection is RVXX1508. Volvo's number for the replacement of drag links is RVXX1509.

15V-651

Mercedes-Benz USA LLC (Mercedes-Benz) is recalling certain model year 2014 S63 AMG sedans and 2015-2016 S63 AMG 4Matic sedans and coupes manufactured May 14, 2013, to September 18, 2015. In the affected vehicles, due to a software error within the engine control unit, the vehicle may stall when coasting to a stop, such as at a traffic light. The vehicle stall may be interpreted by the driver to be a planned shut-down as part of the ECO-Start-function. However, the engine will not restart automatically after releasing the brake pedal, immobilizing the vehicle and increasing the risk of a crash. Mercedes-Benz will notify owners, and dealers will update the engine control unit software, free of charge. The recall is expected to begin on December 8, 2015. Owners may contact Mercedes-Benz customer service at 1-800-367-6372. Mercedes-Benz's number for this recall is 2015100003.

15V-652

The RV Factory LLC (RV Factory) is recalling certain model year 2015-2016 Avion Azure motorhomes

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

manufactured January 1, 2014, to September 24, 2015. The affected vehicles may have an improperly placed weld on the underfloor seat bracket used to mount the second row seats. As a result, the bracket may break in a crash. As such, these vehicles fail to comply with the requirements of Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages." If the bracket breaks, the seats may move, increasing the risk of injury in the event of a crash. RV Company will notify owners, and dealers will replace the brackets, free of charge. The recall began on October 24, 2015. Owners may contact RV Company customer service at 1-844-284-6678 ext 106.

15V-653

Newmar Corporation (Newmar) is recalling certain model year 2007-2008 Mountain Aire motorhomes manufactured October 16, 2006, to July 24, 2007, 2007-2008 Essex motorhomes manufactured November 1, 2006, to May 24, 2007 and 2007-2008 Dutch Star motorhomes manufactured October 12, 2006, to June 29, 2007. The affected vehicles have tag axles with wheel bearings that may be adjusted too tight, resulting in their overheating during use. If the wheel bearings overheat, there is an increased risk of a wheel end fire. Newmar will notify owners, and Spartan dealers will check the wheel end bearings for appropriate end play, replacing them as necessary, free of charge. The recall is expected to begin on December 11, 2015. Owners may contact Newmar customer service at 1-800-731-8300 or Spartan customer service at 1-800-543-4277. Newmar's recall number is 15V-548.

15V-654

Mercedes-Benz USA, LLC (MBUSA) is recalling certain model year 2014-2015 B-Class Electric Drive vehicles manufactured November 21, 2013, to May 26, 2015. Due to a communication error within the electric drive system, the electric powertrain unit may shut down, temporarily immobilizing the vehicle and resulting in a loss of propulsion power. A vehicle stall increases the risk of a crash. MBUSA will notify owners, and dealers will update the electric drive system software, free of charge. The recall is expected to begin in December 2015. Owners may contact MBUSA customer service at 1-800-367-6372.

15V-655

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Tacoma trucks manufactured August 20, 2015, to September 10, 2015. In the affected vehicles, incorrect bolts were used to install the driver's knee air bag module. The incorrect bolts may loosen over time and affect the performance of the driver's knee air bag, increasing the risk of driver injury during a crash that necessitates deployment of the air bags. Toyota will notify owners, and dealers will install the correct driver's knee air bag module mounting bolts, free of charge. The recall is expected to begin by December 12, 2015. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is F0T.

15V-656

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2015 S550 4Matic Coupe, AMG S63 4Matic Coupe, and AMG S65 vehicles manufactured January 27, 2014, to April 2, 2015. In the affected vehicles, left-side front seat belts may have been installed on the right-side and vice versa. As a result, the installation angle may be incorrect, affecting the seat belt locking behavior. Additionally, the child seat restraint function for the passenger seat would not be available. As such, these vehicles fail to comply with the

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection," and FMVSS number 209, "Seat Belt Assemblies." If the seat belt is installed improperly, it may not properly restrain the seat occupant in the event of a crash, increasing the risk of injury. MBUSA will notify owners, and dealers will inspect the installation of the seat belts, correcting them as necessary, free of charge. The recall is expected to begin in October 2015. MBUSA's recall number is 2015100002. Owners may contact MBUSA customer service at 1-800-367-6372.

15V-657

Airstream, Inc. (Airstream) is recalling certain model year 2015-2016 Interstate Grand Tour Extended vehicles manufactured July 11, 2014, to September 1, 2015, and Interstate Lounge Extended vehicles manufactured November 21, 2014, to September 1, 2015. The affected vehicles may have electrical wiring connections that were not properly tightened and an interior wiring harness grounding wire that was installed incorrectly. If the electrical connections are loose, or the ground wire is located incorrectly, the wiring may overheat, increasing the risk of a fire. Airstream will notify owners, and dealers will tighten all of the wiring connections and relocate the wiring harness ground wire, free of charge. The recall began on November 12, 2015. Owners may contact Airstream customer service at 1-937-596-6111 extension 7401 or 7411.

15V-658

Forest River, Inc. (Forest River) is recalling certain model year 2016 Surveyor travel trailers and fifth wheels, models SVT321BHTS, SVT33RETS, SVT32RLTS, SVT33RLTS and SVT32RETS, manufactured April 13, 2015, to October 6, 2015. In the affected vehicles, the power supply wire for the room slide mechanism may have been incorrectly installed such that it doesn't pass through a circuit breaker. Without the power supply wire being properly connected to a circuit breaker, an excessive power draw or electrical short may result in melted wires and an increased risk of a fire. Forest River will notify owners, and dealers will inspect the vehicles and correct the power supply wire installation if needed. Damaged power supply wires will be replaced as necessary. These repairs will be performed free of charge. The recall began on November 3, 2015. Owners may contact Forest River customer service at 1-574-642-3119 extension 205. Forest River's number for this recall is 37-10142015-0098.

15V-659

BMW of North America, LLC (BMW) is recalling certain model year 2002-2005 MINI Cooper and Cooper S vehicles and 2005 Cooper and Cooper S Convertible vehicles. The affected vehicles may experience temporary or permanent loss of the electro-hydraulic steering assistance. If the vehicle experiences a loss of power steering assist, extra steering effort will be required at lower speeds, potentially increasing the risk of a vehicle crash. MINI will notify owners, and dealers will inspect the electro-hydraulic power steering system, replacing the components and wiring, as necessary, free of charge. The recall is expected to begin December 1, 2015. Owners may contact MINI customer service at 1-866-825-1525.

15V-660

Chrysler (FCA US LLC) is recalling certain model year 2015-2016 Ram 1500 trucks manufactured June 17, 2015, to September 28, 2015. The affected vehicles may have been built with rear axles that were incorrectly heat treated. If the rear axle shaft was not properly heated treated, it may fracture and a wheel separation could

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING OCTOBER 2015

Published November 18, 2015

occur, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect the vehicles and replace the axle assemblies, as necessary, free of charge. The recall is expected to begin on November 23, 2015.

Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R59.

15V-661

Mercedes-Benz USA, LLC (Mercedes-Benz) is recalling certain model year 2015 CLA250, CLA250 4Matic, GLA250, GLA250 4Matic, and 2016 SLK300 roadster vehicles manufactured July 17, 2015, to August 31, 2015. The affected vehicles have intake or exhaust camshafts whose welds may fail and possibly cause engine damage. Engine damage may result in a stall, increasing the risk of a crash. Mercedes-Benz will notify owners, and dealers will replace the affected camshafts, free of charge. The recall is expected to begin November 30, 2015. Owners may contact Mercedes-Benz customer service at 1-800-367-6372. Mercedes-Benz's number for this recall is 2015100006.

15V-662

Chrysler (FCA US LLC) is recalling certain model year 2016 Ram 1500 trucks with a 5.7L engine and dual exhaust manufactured August 3, 2015, to August 10, 2015. The affected vehicles may be missing a heat shield for the spare tire. Without a heat shield, heat from the exhaust system may damage the spare tire. When used, the damaged tire may have a tread separation or side wall rupture, resulting in a loss of control and an increased risk of a crash. Chrysler will notify owners, and dealers will install a spare tire heat shield if the vehicle is missing one. Vehicles that have already been sold with an excess of 50 miles will also have their spare tires replaced. These repairs will be performed free of charge. The recall is expected to begin on December 1, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R58.

15V-663

Winnebago Industries, Inc (Winnebago) is recalling certain model year 2015-2016 Winnebago Brave, Sightseer, Vista and Adventurer motorhomes and Itasca Tribute, Sunova, Sunstar, and Suncruiser motorhomes manufactured from July 13, 2015, through October 6, 2015. The affected vehicles, built on Ford chassis, can be shifted out of 'PARK' without applying the brakes, due to an incorrect shift cable bracket and an improper shift cable adjustment. If the vehicle can be shifted into reverse without the brakes being applied, the vehicle may unintentionally move, increasing the risk of a crash. Ford will notify owners, and Ford dealers will replace the transmission shift control bracket and adjust the transmission shift cable, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Winnebago customer service at 1-641-585-3535 or Ford customer service at 1-866-436-7332.

15V-664

Honda (American Honda Motor Co.) is recalling certain model year 2008-2009 Honda Accord vehicles manufactured January 22, 2007, to June 30, 2008. In the affected vehicles, the side impact sensor calibrations may be overly sensitive, and as a result, the side air bag inflatable curtains and/or seat air bags may unexpectedly deploy when the ignition is on and the door is slammed or there is an impact with road debris. Air bags that unexpectedly deploy increase the risk of a crash or injury. Honda will notify owners, and dealers will update the air bag control unit software, free of charge. The recall is expected to begin on December 14, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JV4.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

15V-665

General Motors LLC (GM) is recalling certain model year 2015 Buick LaCrosse, Cadillac XTS, Chevrolet Camaro, Equinox, Malibu, and GMC Terrain vehicles. The affected vehicles have front seat-mounted side impact air bags whose inflator may rupture upon its deployment. In the event of a crash necessitating deployment of one or both of the side impact air bags, the air bag's inflator may rupture and the air bag may not properly inflate. The rupture could cause metal fragments to strike the vehicle occupants, potentially resulting in serious injury or death. Additionally, if the air bag does not properly inflate, the driver or passenger is at an increased risk of injury. GM will notify owners, and dealers will replace the side impact air bag modules, free of charge. The recall began on October 19, 2015. Owners may contact Buick customer service at 1-800-521-7300, Chevrolet customer service at 1-800-222-1020, Cadillac customer service at 1-800-458-8006, or GMC customer service at 1-800-462-8782. GM's number for this recall is 01320.

15V-666

Spartan Motors USA (Spartan) is recalling certain model year 2012 Utilimaster Walk-In Vans manufactured September 26, 2011, to June 25, 2012. The affected vehicles have an undercarriage ramp that may rub against a hydraulic brake line. Contact between the ramp and the brake line may cause a hole in the brake line resulting in a loss of brake fluid and lengthening the distance needed to stop the vehicle, increasing the risk of a crash. Utilimaster will notify owners, and dealers will install a new hydraulic brake line that will not contact the undercarriage ramp, free of charge. Owners may contact Utilimaster customer service at 1-800-582-3454. Spartan's number for this recall is 15023.

15V-667

Honda (American Honda Motor Co.) is recalling certain model year 2016 Honda Pilot 2WD vehicles manufactured May 4, 2015, to September 8, 2015 and 2016 Pilot 4WD vehicles manufactured May 7, 2015 to September 4, 2015. In the affected vehicles, when one of the safety systems such as tire pressure monitoring, anti-lock braking or electronic stability control malfunctions, there is potential that the instrument panel will not illuminate the corresponding warning light, however the warning lamps will illuminate when the ignition is turned off and then turned back on. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic stability control systems", number 135, "Light vehicle brake systems" and number 138, "Tire pressure monitoring systems". If a safety system cannot immediately warn the driver when needed, the driver may be at an increased risk of a crash. Honda will notify owners, and dealers will update the instrument cluster software, free of charge. The recall is expected to begin November 27, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JV7.

15V-668

Starcraft RV (Starcraft) is recalling certain model year 2016 Travel Star travel trailers, models G2JB5099-5101, JD5093-5094, JF5079, JG5067, and JN5065-5066; and Launch Ultra Lite travel trailers, models G2JM5112-5113, JR5187-5197, JS5179-5196, JT5533-5639, JU5121-5155, and JZ5128-5160, manufactured from August 7, 2015, through October 6, 2015. In the affected trailers, the water heater may be improperly wired such that the warning light will not illuminate to let the operator know that the gas is on but did not ignite. If the

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

warning light does not illuminate to notify the operator that the gas did not ignite, a buildup of gas may result, increasing the risk of fire in the presence of an ignition source. Starcraft will notify owners, and dealers will correct the water heater wiring, free of charge. The recall is expected to begin during November 2015. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902261.

15V-669

Spartan Motors USA (Spartan) is recalling certain model year 2014-2015 Utilimaster Vans manufactured July 11, 2014, to September 22, 2015. The affected vehicles may be equipped with a Tire placard that indicates the wrong cargo capacity information. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 110, "Tire Selection and Rims." An incorrect label may result in the vehicle being overloaded which can cause tire failure and increase the risk of a crash. Utilimaster will notify owners and will send a label with the cargo capacity information corrected, free of charge. The recall is expected to begin during November 2015. Owners may contact Utilimaster customer service at 1-800-582-3454. Spartan's number for this recall is 15024.

15V-670

Starcraft RV (Starcraft) is recalling certain model year 2014-2016 Launch Ultra Lite travel trailers, model 28BHS JU, manufactured from October 31, 2013, through October 1, 2015. The affected trailers are equipped with a Happy Jack bed that will try to lift up too far, damaging the bed's brackets and motor. Damage to the bed's brackets and motor may cause the bed to break and possibly fall onto anyone that may be under it, increasing their risk of injury. Starcraft will notify owners, and dealers will reposition the bed's brackets so that it will not lift up too far, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's recall campaign number is 9902267.

15V-671

Volvo Trucks North America (Volvo) is recalling certain model year 2016 Volvo VN trucks manufactured on August 13, 2015. The affected vehicles are equipped with certain Cummins engines whose engine control module (ECM) may short circuit and blow a fuse resulting in the engine stalling without warning. An engine that stalls without warning increases the risk of a crash. Cummins will notify owners on behalf of Volvo, and will replace any defective ECM, free of charge. The recall began in October 2015. Owners may contact Cummins customer service at 1-800-343-7357. Cummins' number for this recall is C1698. Owners may also contact Volvo customer service at 1-800-528-6586. Volvo's number for this recall is RVXX1511.

15V-672

Chrysler (FCA US LLC) is recalling certain model year 2003 Jeep Liberty vehicles manufactured March 29, 2003, to July 3, 2003, and 2004 Jeep Grand Cherokee vehicles manufactured May 27, 2003, to May 20, 2004. Due to electrical noise beyond the tolerance of the air bag electronic control module (ECM), a component in the ECM may fail, causing the front air bags, side air bags, and/or seatbelt pretensioners to deploy inadvertently while the vehicle is being operated. Inadvertent deployment of the air bags may increase the risk of injury and the possibility of a vehicle crash. Chrysler will notify owners, and dealers will replace the air bag electronic control module and the front and/or side impact sensors, as necessary, free of charge. The replacement parts needed for this remedy are not expected to be available until the later part of 2016. Owners

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

will be mailed an interim notification by the end of November 2015 and will be mailed a follow up notification when new air bag control modules are available in late 2016. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R60.

15V-673

Mazda North American Operations (Mazda) is recalling certain model year 1989-1998 MPV, 1990-1995 323, 1990-1998 Protege, 1992-1993 MX-3, 1993-1995 929, 1993-1997 MX-6, and 1993-1998 626 vehicles. In the affected vehicles, grease applied to the contact points inside the ignition switch may become conductive and overheat. If the ignition switch overheats there would be an increased risk of a fire. Mazda will notify owners, and dealers will replace the ignition switch, free of charge. The recall is expected to begin December 15, 2015. Owners may contact Mazda Customer Experience Center at 1-800-222-5500, option#6. Mazda's number for this recall is 8715J.

15V-674

Chrysler (FCA US LLC) is recalling certain model year 2012-2015 Dodge Journey vehicles manufactured April 21, 2012, to April 14, 2015. In the affected vehicles, water may enter the wiring harness for the Anti-lock Brake System (ABS) module and leak into the module, disabling the ABS and/or the Electronic Stability Control (ESC) system. If the ABS or ESC is disabled, a loss of vehicle stability could occur, increasing the risk of a crash. Chrysler will notify owners, and dealers will seal the ABS wiring harness to prevent water from entering and will replace the ABS module and repair the headlamp and dash wiring harness, as necessary. These repairs will be performed free of charge. The recall is expected to begin on December 4, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R61.

15V-675

Chrysler (FCA US LLC) is recalling certain model year 2015 Jeep Cherokee vehicles manufactured October 1, 2014, to June 18, 2015. The affected vehicles may have a misrouted air conditioning suction/discharge hose. If the line is misrouted, it may contact the exhaust manifold, increasing the risk of a vehicle fire. Chrysler will notify owners, and dealers will inspect the routing of the air conditioning hose. Any hose that is misrouted will be replaced and installed correctly. This work will be performed free of charge. The recall is expected to begin on November 23, 2015. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is R57.

15V-676

Mazda North American Operations (Mazda) is recalling certain model year 2008 Tribute vehicles manufactured February 9, 2007 to April 22, 2008. The affected vehicles have had their CD4E transmission replaced with remanufactured one that was rebuilt between June 11, 2015 through July 15, 2015. These service repair part transmissions have a shift lever bolt that may not be properly tightened. As a result, the shift control lever could disengage from the transmission without warning. If the shift lever disengages from the transmission, a driver may be unable to shift gear positions and the indicated shift position may not represent the gear position the vehicle is in. Should a disengagement occur while the vehicle is being driven, when the driver goes to stop and park the vehicle, the gear selection indicator may show that the transmission is in the "PARK" position, but the vehicle transmission may not actually be in the "PARK" gear position. If the vehicle is not in the "PARK" position there

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

is a risk the vehicle will roll away as the driver and other occupants exit the vehicle or anytime thereafter. A vehicle rollaway increases the risk of injury to exiting occupants and bystanders. Mazda will notify owners, and dealers will inspect the transmission and if necessary tighten the manual shift lever bolt or replace the manual shift lever assembly, free of charge. The recall is expected to begin in December 2015. Owners may contact Mazda Customer Experience Center at 1-800-222-5500, option#6. Mazda's number for this recall is 8815J.

15V-677

Hyundai Motor America (Hyundai) is recalling certain model year 2015-2016 Sonata vehicles manufactured May 28, 2014, to August 21, 2015. The affected vehicles are equipped with an Antilock Braking System (ABS) warning light intended to warn the driver if there is an ABS malfunction. In the event of an ABS malfunction, the Brake System warning light will illuminate, but the ABS warning light will not illuminate. Since the vehicles have ABS malfunction lights that do not illuminate, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems." If the driver is alerted there is a brake system malfunction, but not specifically with the ABS system, the driver may operate the vehicle unaware that the vehicle's brakes may lock up during hard braking, increasing the risk of a crash. Hyundai will notify owners, and dealers will update the ABS control unit software, free of charge. The recall is expected to begin December 11, 2015. Owners may contact Hyundai customer service at 1-855-671-3059. Hyundai's number for this recall is 134.

15V-678

Fontaine Modification is recalling certain model year 2014-2016 Freightliner M2 vehicles converted to be equipped with dual steering wheels by Fontaine Modification between March 13, 2015 and September 1, 2015. In the affected vehicles, a connecting pin in the dual steering linkage may break or fall out resulting in the momentary loss of steering or steering lock up. A momentary loss of steering or steering lock up increases the risk of a crash. Fontaine Modification will notify owners and supply a steering linkage connection remedy kit for Freightliner dealers to install free of charge. The recall is expected to begin in November 2015. Owners may contact Fontaine Modification customer service at 1-800-366-8246.

15V-679

Starcraft RV (Starcraft) is recalling certain model year 2015-2016 Launch, Launch Ultra, AR-One, AR-One Maxx, Autumn Ridge, and Travel Star travel trailers manufactured July 9, 2015, to October 2, 2015. The affected trailers have a circuit breaker box with circuit breakers that may be mislabeled. With an incorrectly labeled circuit breaker box, someone may turn off the wrong breaker to work on the electrical system and receive an electrical shock. Starcraft will notify owners, and will send owners a corrected circuit breaker box label, free of charge. The recall is scheduled to begin during November 2015. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902060.

15V-680

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2015 Altima and Pathfinder vehicles, 2013-2014 Nissan Sentra vehicles, 2013 Infiniti JX35 vehicles, 2014-2015 Infiniti QX60 vehicles and 2014 Infiniti QX60 Hybrid vehicles. The affected vehicles received an incorrect occupant classification system (OCS) control unit during a repair. These OCS control units may incorrectly classify the front passenger seat as empty,

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

when it is occupied by an adult. If the OCS does not detect an adult occupant in the passenger seat, the passenger air bag would be deactivated. Failure of the passenger airbag to deploy during a crash (where deployment is warranted) could increase the risk of injury to the passenger. Nissan will notify owners, and dealers will update the OCS software, free of charge. The recall is expected to begin in November 2015. Owners may contact Nissan at 1-800-647-7261.

15V-681

Volvo Trucks North America (Volvo) is recalling certain model year 2016 VN trucks manufactured January 6, 2015, to January 15, 2015, equipped with certain Eaton Fuller FR-Series 10-speed manual transmissions. In the affected vehicles, when the transmission shift lever is moved from reverse to neutral, the reverse gear may stay engaged. When the transmission shift lever is moved from reverse to a forward gear position, the transmission may mechanically lock because both the reverse gear and forward gear are simultaneously engaged. Even though the transmission has been shifted out of reverse into neutral, the vehicle may unexpectedly move backwards, increasing the risk of a crash. The remedy for this recall is still under development. The recall is expected to begin December 15, 2015. Owners may contact Volvo customer service at 1-800-528-6586, or Eaton customer service at 1-800-826-4357. Volvo's number for this recall is RVXX1510.

15V-682

Corp. Micro Bird (Micro Bird) is recalling certain model year 2012-2015 Micro Bird MB II school buses manufactured July 3, 2012, to September 14, 2015. The affected buses were incorrectly tested to verify their roof strength and rollover protection and therefore cannot be assured to protect the occupants during a rollover. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 220, "School Bus Rollover Protection." In a school bus rollover, risk of injury would be increased. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule for this campaign. Owners may contact Micro Bird customer service at 1-819-477-2012.

15V-683

Corp. Micro Bird Inc. (Micro Bird) is recalling certain model year 2015 T-Series school buses manufactured August 24, 2015, to September 17, 2015, and built on Ford Transit Chassis. The affected vehicles have the electrical wire of the heated cross view mirror on the passenger entrance door side connected to the same electrical harness as the heated and remote rear view mirror. The diameter of this electrical wire is not sufficient for the amperage required for all of the heated mirrors. The insufficient diameter may cause the electrical wire to overheat, increasing the risk of a fire. Micro Bird will notify owners, and dealers will install a separate connection for the passenger entrance door mirror, free of charge. The recall began on November 4, 2015. Owners may contact Micro Bird customer service at 1-819-477-2012 extension 364. Micro Bird's number for this recall is 15-061-MUS.

15V-684

Jayco, Inc. (Jayco) is recalling certain model year 2016 Eagle Half Ton (HT) fifth wheel trailers manufactured May 19, 2015, to October 8, 2015. The affected vehicles do not have warning labels on the towing hitch to identify the maximum gross vehicle weight rating (GVWR) for towing, maximum tongue weight and towing vehicle braking information. A vehicle operator could unknowingly overload the trailer, which may result in tire or

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

axle failure and increase the risk of a crash. Jayco will notify owners, and dealers will apply the proper warning label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Jayco customer service at 1-800-283-8267. Jayco's number for this recall is 9901265.

15V-685

Maserati North America, Inc. (Maserati) is recalling certain model year 2014 Quattroporte GTS V8 vehicles manufactured October 1, 2013, to December 31, 2013. In the affected vehicles, the battery positive cable for the alternator and starter motor may not have its insulating cap installed properly at the starter motor. Additionally, the cable may not be adequately secured in the engine bay. These factors may result in the cable shorting to ground. If the battery positive cable shorts to ground, the wiring harness may overheat, resulting in a fire. The car also may stall, increasing the risk of a crash. Maserati will notify owners, and dealers will inspect the vehicle to verify that the starter motor cable has a properly installed protective cap and that the cable is adequately secured. If not, the starter motor cable assembly will be replaced. These repairs will be performed free of charge. The recall began on November 11, 2015. Owners may contact Maserati customer service at 1-201-816-2600. Maserati's number for this recall is 279.

15V-686

Spartan Motors USA (Spartan) is recalling certain model year 2009-2014 ER Gladiator and MetroStar vehicles manufactured January 5, 2010, to January 19, 2015. In the affected vehicles, the power steering fluid may overheat and cause the steering to unexpectedly lock during steering maneuvers. If the steering locks, there could be a loss of control of the vehicle, increasing the risk of a crash. Spartan will notify owners, and dealers will install a cooler to prevent the steering fluid from overheating, free of charge. The recall is expected to begin November 20, 2015. Owners may contact Spartan customer service at 1-800-543-4277.

15V-687

Bentley Motors, Inc. (Bentley) is recalling certain model year 2012-2014 Continental GT vehicles manufactured February 1, 2011, to April 30, 2014, 2012-2015 Continental GTC vehicles manufactured February 1, 2011, to June 30, 2014, 2012-2013 Continental Flying Spur vehicles manufactured March 31, 2011, to August 30, 2012, and 2014 Flying Spur vehicles manufactured February 28, 2013, to April 28, 2014. In the affected vehicles, a battery cable connection may be loose at the firewall. A loose battery cable may overheat, increasing the risk of a fire. Bentley will notify owners, and dealers will replace the battery cable securing nut, free of charge. The recall began on November 17, 2015. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE15/15.

15V-688

Toyota Motor Company (Toyota) is recalling certain model year 2009-2011 Tundra, Sequoia, Corolla, Corolla Matrix and Scion xB, 2008-2011 Highlander and Highlander Hybrid, 2007 Camry and Camry Hybrid, 2009 Camry and Camry Hybrid, 2006-2011 RAV4, 2006-2010 Yaris, and 2009-2010 Scion xD and Pontiac Vibe vehicles. During the manufacturing of the Power Window Master Switch (PWMS), grease lubricant may have been inconsistently applied to the sliding electrical contacts. If the sliding electrical contacts are not protected by lubricant, debris and moisture that get into the switch may cause a short circuit and the switch assembly may overheat and melt, increasing the risk of a fire. Toyota will notify owners, and dealers will inspect the switch,

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING OCTOBER 2015

Published November 18, 2015

applying a lubricant if no abnormality is found. If abnormality is found, the PWMS circuit board will be replaced, free of charge. The recall is expected to begin December 20, 2015. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is COM.

15V-689

Mack Trucks, Inc. (Mack) is recalling certain model year 2014 Granite (GU) trucks manufactured January 1, 2013, to October 16, 2013, and equipped with certain drive axles manufactured by Marmon-Herrington. The affected axles are equipped with hex nuts on the flange yoke that may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. Mack will notify owners, and dealers will inspect the hex nut, tightening it to proper torque, free of charge. The recall is expected to begin on November 30, 2015. Owners may contact Mack customer service at 1-800-528-6586. Mack's number for this recall is SC0397.

15V-690

Blue Bird Body Company (Blue Bird) is recalling certain model year 2016-2017 Vision school buses manufactured September 3, 2015, to September 18, 2015. In the affected vehicles, the windshield wiper motor harness connector may have been installed incorrectly, causing the wiper system to stop without warning. An inoperative windshield wiper may reduce the driver's visibility during inclement weather, increasing the risk of a crash. Blue Bird will notify owners, and dealers will inspect and correct the wiper motor connection, free of charge. The recall is expected to begin on November 25, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YH-SB.

15V-691

Starcraft RV (Starcraft) is recalling certain model year 2016 Autumn Ridge trailers, model 339BHTS, manufactured March 27, 2015, to September 22, 2015. The affected trailers have liquid propane (LP) lines and wires routed under the travel trailer. These LP lines and wires may be inadequately protected from road debris. Road debris may damage the LP lines and electrical wires, increasing the risk of a propane leak and an electrical short. These conditions may result in a fire. The remedy for this recall is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Starcraft customer service at 1-800-945-4787. Starcraft's number for this recall is 9902266.

15V-692

Navistar, Inc. (Navistar) is recalling certain model year 2016 International ProStar trucks manufactured January 5, 2015, to January 7, 2015, and 2016 International TranStar trucks manufactured on January 6, 2015, and equipped with certain Eaton Fuller FR-Series 10-speed manual transmissions. When the transmission shift lever is moved from reverse to neutral, the reverse gear may stay engaged. When the transmission shift lever is moved from reverse to a forward gear position, the transmission may mechanically lock because both the reverse gear and forward gear are simultaneously engaged. Even though the transmission has been shifted out of reverse into neutral, the vehicle may unexpectedly move backwards, increasing the risk of a crash. Navistar will notify owners, and dealers will inspect the transmission. Any affected transmission will be repaired or replaced, free of charge. The recall is expected to begin November 30, 2015. Owners may contact Navistar customer service at 1-800-343-7357. Navistar's number for this recall is 15516.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

15V-693

Halcore Group, Inc. (Halcore) is recalling certain model year 2008-2014 American Emergency Vehicle (AEV) Type II ambulances manufactured February 1, 2008, to August 1, 2014. In the affected vehicles, the flexible steel cable that connect the seat belt to the vehicle on the rearward facing attendant seat may be bent from being sat on while entering the vehicle. This repeated bending may result in the cable breaking. If the cable breaks, the seat occupant may not be properly restrained in the event of a crash, increasing their risk of injury. Halcore will notify owners, and dealers will replace the flexible steel cable with a sleeve encased webbed belt which allows flexibility, free of charges. The recall is expected to begin November 30, 2015. Owners may contact AEV customer service at 1-800-374-9749.

15V-694

BMW of North America, LLC (BMW) is recalling one model year 2015 Rolls-Royce Ghost manufactured on January 23, 2014. The affected vehicle has thorax air bags fitted to both front seats that may fail to meet the side impact performance requirements for the front seat occupants. As such, this vehicle may fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection." In the event of a vehicle crash necessitating air bag deployment, this may increase the risk of injury to the front seat passengers. A Rolls-Royce dealer will replace the driver-side and passenger-side thorax air bag modules, free of charge. The recall began October 22, 2015. Owners may contact Rolls-Royce at 1-877-877-3735.

15V-695

Blue Bird Body Company (Blue Bird) is recalling one 2017 Vision transit bus. In the affected vehicle, the windshield wiper motor harness connector may have been installed incorrectly, causing the wiper system to stop without warning. Inoperative windshield wipers may decrease the driver's visibility during inclement weather, increasing the risk of a crash. Blue Bird will notify the owner, and a dealer will inspect and repair the wiper motor connection, free of charge. The recall is expected to begin on November 25, 2015. Owners may contact Blue Bird customer service at 1-478-822-2242. Blue Bird's number for this recall is R15YH-NSB.

15V-696

Honda (American Honda Motor Co.) is recalling certain model year 2015-2016 Fit LX-trim vehicles manufactured April 11, 2014, to July 02, 2015 and not equipped with a sunroof. In the affected vehicles, the rear grab handle brackets were not manufactured properly, and as a result, the brackets may puncture the side curtain air bags upon their deployment. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection" and number 226, "Ejection Mitigation". If the side curtain air bags are punctured upon deployment, the outboard seat occupants may be at a higher risk of injury during a crash. Honda will notify owners, and dealers will replace the rear grab handle bracket, free of charge. The recall is expected to begin December 4, 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JV8.

15V-697

Thor Motor Coach (TMC) is recalling certain model year 2009-2011 Four Winds Hurricane and Windsport, 2009-2010 Four Winds Mandalay, 2010 Four Winds Magellan, and 2010-2011 Four Winds Serrano

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

motorhomes manufactured May 2, 2009, to September 1, 2010. The affected vehicles are wired to be powered by a generator and are equipped with an Iota ITS-50R transfer switch that may fail when exposed to elevated electrical loads and used in higher ambient temperatures. As the transfer switch fails, it may overheat, increasing the risk of a fire. TMC will notify owners, and dealers will replace the Iota ITS-50R transfer switch with a transfer switch from another manufacturer, free of charge. The recall is expected to begin November 30, 2015. Owners may contact Thor customer service at 1-877-855-2867. Thor's number for this recall is RC000106.

15V-698

Thor Motor Coach (TMC) is recalling certain model year 2016 Challenger, Hurricane and Windsport motorhomes manufactured July 31, 2015, to September 9, 2015. In the affected vehicles, the parking brake actuator may be out of calibration causing the parking brake system to not properly hold the vehicle even with the parking brake pedal fully depressed. Additionally, the parking brake may not disengage completely when the parking brake pedal is released. If the parking brake does not fully engage, the vehicle may unexpectedly roll, increasing the risk of personal injury or a crash. A parking brake that drags may result in a wheel end fire. TMC will notify owners, and dealers will replace the parking brake foot pedal assembly, free of charge. The recall is expected to begin November 23, 2015. Owners may contact TMC customer service at 1-877-855-2867. TMC's number for this recall is RC000107.

15V-699

American Honda Motor Co., Inc. (Honda) is recalling certain model year 2001-2010 and 2012-2015 GL1800, 2001-2005 GL1800A and 2013-2015 GL1800B motorcycles. The rear brakes of the affected motorcycles may drag after the brakes are released. A rear brake that drags may increase the risk of a vehicle crash. Additionally, extended riding with the rear brake dragging could generate enough heat to result in a fire. Honda will notify owners, and dealers will replace the secondary brake master cylinder and the rear brake master cylinder, and flush the brake fluid, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is JV6. Note: This recall supercedes recall 14V-472.

15V-700

General Motors LLC (GM) is recalling certain model year 1998-1999 Chevrolet Lumina and Oldsmobile Intrigue, 1997-2004 Buick Regal and Pontiac Grand Prix, 2000-2004 Chevrolet Impala, and 1998-2004 Chevrolet Monte Carlo vehicles. The affected vehicles were previously repaired under recalls 08V-118, 09V-116, and 15V-201 to address the possibility that engine oil may drip onto the hot exhaust manifold. Engine oil that drips onto the hot surface of the exhaust manifold may result in a fire. The remedy applied under recalls 08V-118, 09V-116, and 15V-201 did not adequately remove the safety risk. GM is finalizing an improved remedy. Vehicles that are covered by recalls 08V-118, 09V-116, or 15V-201 that have not yet received the original remedy will instead receive the improved remedy under the original recall number, once the improved remedy has been finalized. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, Buick customer service at 1-800-521-7300, Oldsmobile customer service at 1-800-442-6537 and Pontiac customer service at 1-800-458-8006. GM's number for this recall is 15757. Note: Until the improved remedy has been applied, owners are advised to park their vehicle outside since the fire risk exists even when the vehicle is unattended.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

15V-701

Mack Trucks, Inc. (Mack) is recalling certain model year 2010-2016 Granite (GU), LR, and TerraPro (LEU, MRU) trucks manufactured November 17, 2009 to October 17, 2015. The affected trucks have engines with a turbocharger oil supply line that may contact or interfere with the turbocharger inlet elbow, clean air intake clamp, or the air fuel control tube, and result in an oil leak. If the turbocharger oil supply line oil leaks in the proximity of the engine exhaust manifold there would be an increased risk of a fire. Cummins will notify owners on behalf of Mack, and dealers will inspect for oil supply line interference or damage, eliminating the interference and replacing the oil supply line, as necessary, free of charge. The recall is expected to begin November 30, 2015. Owners may contact Cummins at 1-800-343-7357 or Mack customer service at 1-800-866-1177. Cummins' number for this recall is SC0396.

15V-702

Terex Advance (Terex) is recalling certain model year 2011-2015 FD4000B, FD5000D, FD6000B, and FD7000B concrete mixers manufactured January 1, 2011, to September 1, 2015. The affected vehicles have steerable tag axles operated by Eaton Hydraulics S26 Gear Pumps. These gear pumps may unexpectedly fail, reducing the ability to properly steer the vehicle. The loss of steering ability may increase the risk of a crash. Terex will notify owners, and dealers will replace the S26 gear pumps, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex customer service at 1-800-433-6691.

15V-703

Isuzu Manufacturing Services of America (Isuzu) is recalling certain model year 2006-2008 Isuzu NPR and NPR-HD and Chevrolet W3500 and W4500 trucks manufactured March 16, 2005, to August 13, 2008 and 2006-2008 GMC W3500 and W4500 trucks manufactured July 18, 2005, to August 13, 2008. The affected vehicles have a fuel tank that may corrode and leak fuel. A fuel leak in the presence of an ignition source increases the risk of a fire. Isuzu will notify owners, and dealers will replace the fuel tank, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Isuzu customer service at 1-866-441-9638.

15V-704

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain model year 2015-2016 Jetta, Beetle, Beetle Convertible, Passat, Golf and Golf SportWagen vehicles. In the affected vehicles, the camshaft lobe that drives the brake vacuum pump may shear off, resulting in a loss of brake assist. If the camshaft lobe shears off there would be a loss of brake assist, lengthening the distance needed to stop the vehicle and increasing the risk of a crash. The remedy for this recall campaign is still under development. Volkswagen will send owners an interim notification by December 22, 2015 and will send a second notification when a remedy plan has been finalized, currently expected to be in March 2016. Owners may contact Volkswagen customer service at 1-800-822-8987. Volkswagen's number for this recall is 23R1.

15V-705

Pierce Manufacturing (Pierce) is recalling certain model year 2015-2016 Arrow XT, Velocity, Enforcer, and

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Saber vehicles manufactured November 20, 2014, to September 29, 2015. The affected vehicles are equipped with front drive axles whose hex nuts on the flange yoke may not have been properly tightened. If the hex nuts are not tightened to specification, the driveshaft may disconnect from the drive axle, resulting in a loss of propulsion and increasing the risk of a crash. Pierce will notify owners, and dealers will inspect the hex nuts, tightening them as necessary, free of charge. The recall is expected to begin during November 2015. Owners may contact Pierce customer service at 1-888-974-3723. Pierce's number for this recall is 74B266.

15V-706

Ford Motor Company (Ford) is recalling certain model year 2016 Ford Mustang vehicles manufactured September 26, 2015, to October 1, 2015. The front and rear seat belts and child seat tether anchors may have been damaged in shipping from the supplier to the vehicle assembly plant and may not adequately restrain the occupant in a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 208, "Occupant Crash Protection," and 225, "Child restraint anchorage systems." If the restraint components do not function as intended, the occupants may not be properly restrained in the event of a crash, increasing their risk of injury. Ford will notify owners, and dealers will replace the front and rear seat belt assemblies and the child seat tether anchors, free of charge. The recall is expected to begin on December 14, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15C13.

15V-707

Fontaine Trailer Company (Fontaine) is recalling certain model year 2014-2016 Revolution flat trailers manufactured September 30, 2013, to September 28, 2015. The affected trailers have welds that may crack where the structural support member attaches to the frame hanger. If the welds crack, the structural member may also crack and the structural support member may separate from the frame hanger resulting in a failure of the slider box, which could increase the risk of a crash. Fontaine will notify owners, and dealers will inspect the trailers and repair any cracks, as necessary. Additional reinforcing components will also be added. These repairs will be performed free of charge. Owners may contact Fontaine customer service at 1-205-485-1300. Fontaine's name for this recall is "Slider Enhancement."

15V-708

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain model year 2016 GLE450 AMG 4Matic coupes and GLE63 AMG S 4Matic coupes manufactured December 10, 2014, to April 29, 2015. The affected vehicles may be equipped with rear drive shaft bolt fasteners that may loosen and result in the rear drive shaft separating from the transmission or the rear axle differential. If the drive shaft separates, the vehicle will stall, increasing the risk of a vehicle crash. MBUSA will notify owners, and dealers will inspect the bolt fasteners, tightening them as necessary, free of charge. The recall is expected to begin in mid-November 2015. Owners may contact MBUSA customer service at 1-800-367-6372.

15V-709

Ford Motor Company (Ford) is recalling certain model year 2009-2010 Ford Edge vehicles manufactured September 11, 2008, to July 1, 2010, and Lincoln MKX vehicles manufactured September 23, 2008, to July 1, 2010, originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky,

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. Due to corrosion from salt water exposure such as from road salt use, the affected vehicles may leak fuel from the fuel tank seam weld under the tank mounting reinforcement brackets. A fuel leak in the presence of an ignition source increases the risk of a fire. Ford will notify owners, and dealers will inspect the vehicles and either clean and treat the fuel tank with a corrosion preventative or replace the tank, free of charge. The recall is expected to begin December 14, 2015. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 15S31.

15V-712

Newmar Corporation (Newmar) is recalling certain model year 2016 Bay Star Sport, Bay Star, and Canyon Star vehicles manufactured July 8, 2015, to September 23, 2015. Due to an incorrect shift cable bracket and an improper shift cable adjustment, the affected vehicles can be shifted out of 'PARK' without applying the brakes. If the vehicle can be shifted into reverse without the brakes being applied, the vehicle may unintentionally move, increasing the risk of a crash. Newmar will notify owners, and Ford dealers will replace the transmission shift control bracket and adjust the transmission shift cable, free of charge. The recall is expected to begin December 23, 2015. Owners may contact Newmar customer service at 1-800-731-8300. Newmar's and Ford's number for this recall is 15S25.

15V-713

American Honda Motor Company, Inc. (Honda) is recalling certain model year 2016 CR-V vehicles manufactured October 12, 2015, to October 19, 2015. The metal housing surrounding the driver's air bag inflator in these vehicles may have been manufactured incorrectly. In the event of a crash necessitating deployment of the driver's frontal air bag, the inflator could rupture with metal fragments striking the driver or other occupants resulting in serious injury or death. Honda will notify owners, and dealers will replace the driver side frontal air bag module, free of charge. The recall began in November 2015. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is JV9.

15V-714

Eldorado National-California, Inc. (Eldorado National) is recalling certain model year 2006-2007 MST and Transmark vehicles manufactured January 1, 2006, to December 30, 2007, and equipped with certain Ricon model S2005, S2010, S5005, S5010, S5505, S5510 wheelchair lifts. The affected lifts are equipped with folding link arms that may have pivot holes that are too big, allowing the bearings to move out of position. If the bearings move out of position, the stowed platform may have excessive movement resulting in failure of the platform mounting. This failure could cause the wheel chair lift platform to fall out of the vehicle when the doors are opened, increasing the risk of injury for the lift operator. Eldorado National-California will notify owners, and Ricon dealers will inspect the link arms for damage or for displaced bearings. The platform will be inspected for cracks. Any damaged parts will be replaced, free of charge. The recall is expected to begin during November 2015. Owners may contact Eldorado National customer service at 1-909-591-9557 or Ricon Customer Service at 1-800-322-2884. Note: These buses and wheelchair lifts were subject to a similar recall in 2014. All vehicles that received that recall remedy are still affected by this recall as well.

15V-715

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING OCTOBER 2015

Published November 18, 2015

Eldorado National-California, Inc. (Eldorado National) is recalling certain model year 2009-2010 Passport buses manufactured April 2, 2009, to June 30, 2010 and equipped with A&M Systems-brand door actuators. Voltage spikes may damage electrical components and electrical circuits, causing the actuator's circuit board to develop high resistance. High resistance may cause the board to overheat, increasing the risk of a fire. Eldorado National will notify owners, and dealers will replace the affected circuit boards, free of charge. The recall is expected to begin during November 2015. Owners may contact Eldorado National customer service at 1-909-591-9557.

15V-716

Porsche Cars North America, Inc. (Porsche) is recalling certain model year 2015-2016 Macan S vehicles manufactured March 27, 2014, to October 27, 2015, and 2015-2016 Macan Turbo vehicles manufactured March 5, 2014, to October 27, 2015. The affected vehicles have a low pressure fuel line in the engine compartment that may leak. A fuel leak in the presence of an ignition source increases the risk of a fire. Porsche will notify owners, and dealers will install an improved low pressure fuel line, free of charge. Parts are not currently available. Porsche mailed an interim notification to owners on November 9, 2015 and will mail a second notice when parts are available. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AF06.

15V-717

BMW of North America, LLC (BMW) is recalling certain model year 2016 528i, 528i xDrive, 535i, 535i xDrive, 535d xDrive, M5, 550i, 550i xDrive, and 535d sedans. The affected vehicles have an inboard lower anchor for child restraints on the left rear seat that may have been bent downwards, preventing the child seat from fully engaging both lower anchors. As such, these vehicles may fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems." If the child seat is not properly attached to the lower anchors, it can increase the child's risk of injury in the event of a crash. BMW will notify owners, and dealers will inspect and, if necessary, repair the inboard lower anchor on the left rear seat, free of charge. The recall is expected to begin December 24, 2015. Owners may contact BMW customer service at 1-800-525-7417.

15V-718

Thor Motor Coach (TMC) is recalling certain model year 2016 Ace, Challenger, Hurricane, Miramar, Outlaw, and Windsport vehicles manufactured July 14, 2015, to October 16, 2015. Due to an incorrect shift cable bracket and an improper shift cable adjustment, the affected vehicles can be shifted out of 'PARK' without applying the brakes. If the vehicle can be shifted into reverse without the brakes being applied, the vehicle may unintentionally move, increasing the risk of a crash. Ford will notify owners on TMC's behalf, and Ford dealers will replace the transmission shift control bracket and adjust the transmission shift cable, free of charge. The recall is expected to begin in November 2015. Owners may contact TMC customer service at 1-877-500-1020. TMC's number for this recall is RC000110.

15V-719